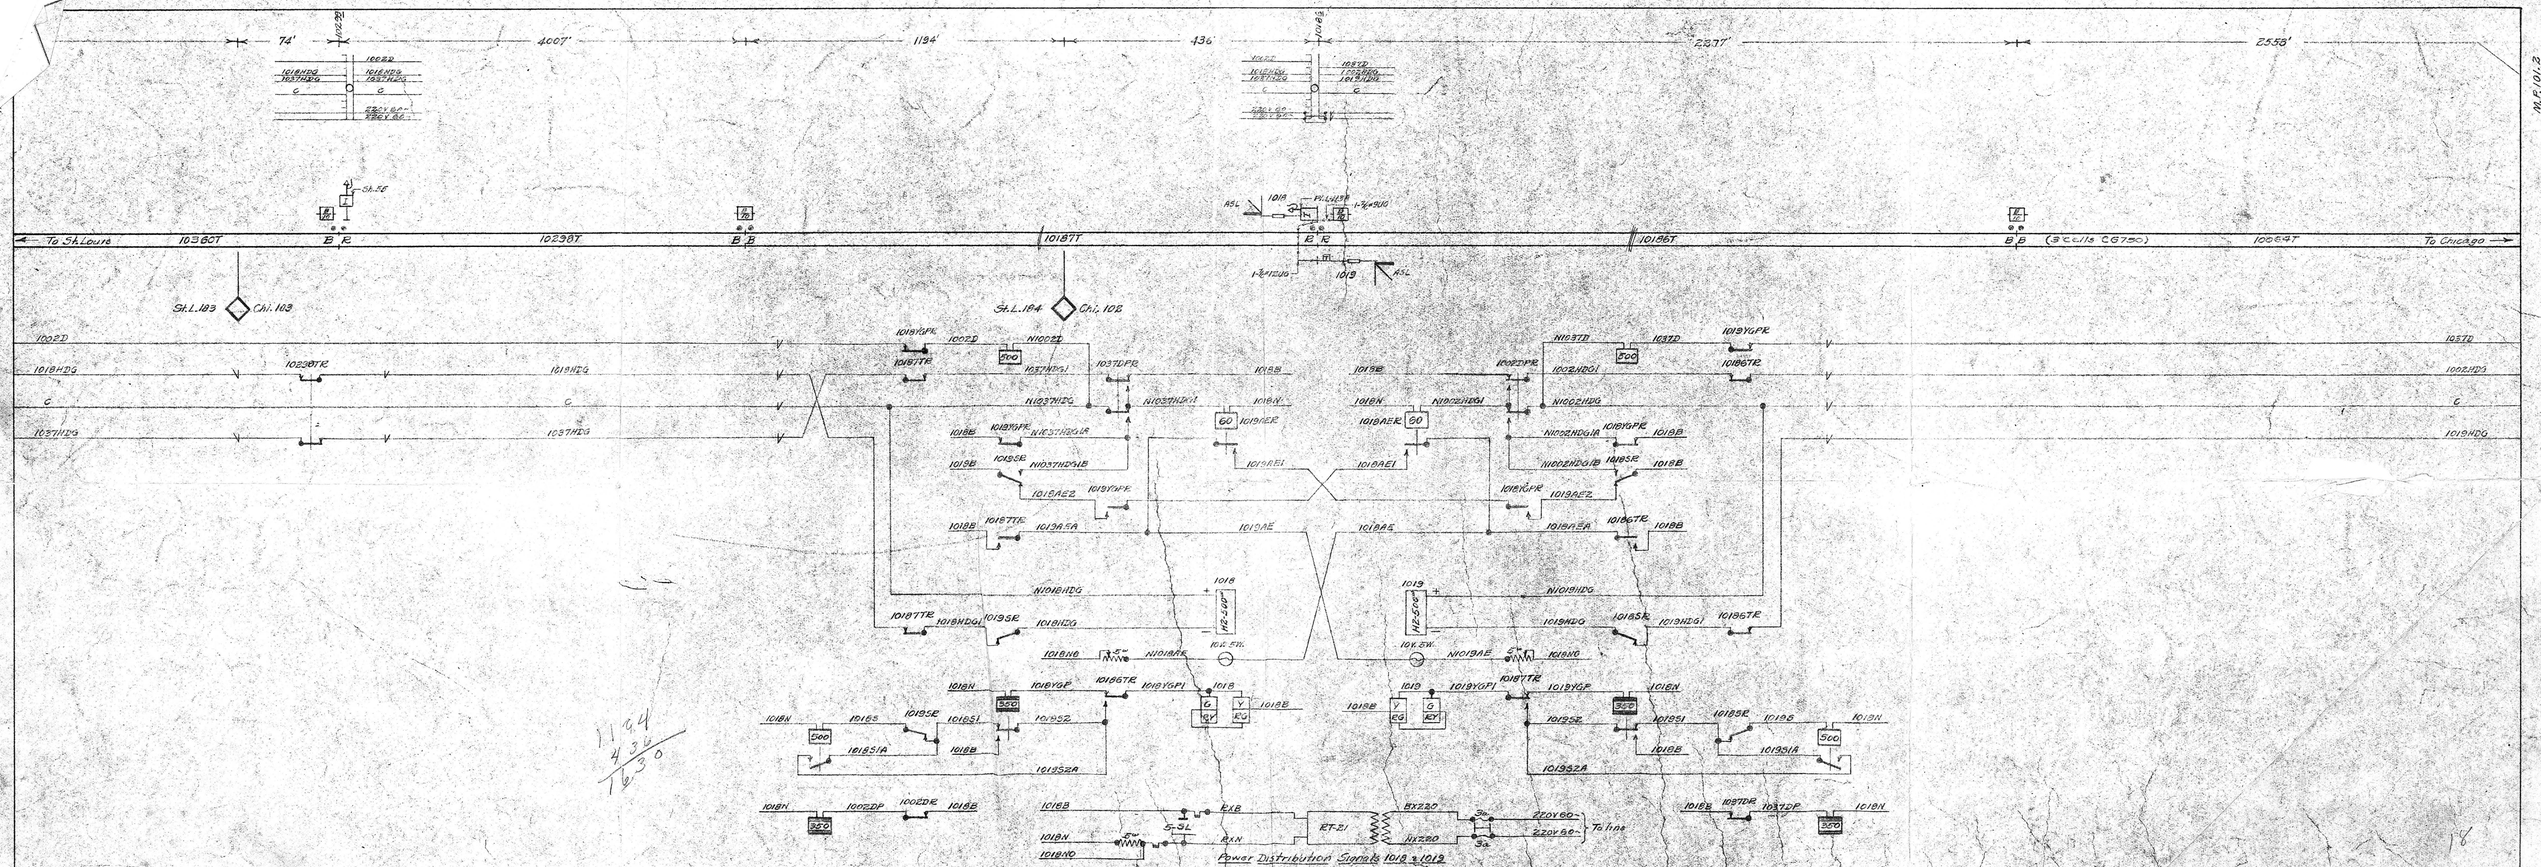

74'
10299
4007'
1194'
436'
1018½
2377'
2553'
M.P. 101.2
1002D
1018HDG
1037HDG
C
220V 60~
1037D
1002HDG
1019HDG
Sh.55
B/10
B/70
To St. Louis
10360T
B R
10238T
B B
10187T
ASL
1018
Pl. L.413B
1-¾"#9UG
R R
1-¾"#12UG
1019
10186T
(3 cells CG750)
10064T
To Chicago
St.L.183
Chi.103
St.L.184
Chi.102
10238TR
1018YGPR
10187TR
500
N1002D
1037HDG1
1037DPR
1018B
1018N
N1037HDG
N1037HDG1
60
1019AER
1018AER
N1002HDG1
1002DPR
N1037D
1002HDG1
N1002HDG
1019YGPR
10186TR
N1037HDG1A
N1037HDG1B
1019SR
1018AE2
1019AE1
1018AE1
N1002HDG1A
N1002HDG1B
1018SR
1019AE2
10187TR
1019A5A
1019AE
1018AE
1018AEA
N1018HDG
HZ-500"
N1019HDG
1018HDG1
1019HDG1
1018NO
5Ω
N1018AE
10V. 5W.
N1019AE
1018YGP
1018YGP1
1019YGP1
1019YGP
G
Y
RY
RG
350
10186TR
1018S
1018S1
1018S1A
1019S
1019S1
1019S1A
1019S2
1019S2A
1002DP
1002DR
1037DR
1037DP
5-SL
RXB
RXN
RT-21
BX220
NX220
3a
220V 60~
To line
Power Distribution Signals 1018 & 1019

1194
436
1630

18

Revision	2 5-21-59	1 9-15-47	
Reference	AFE 7506	A.F.E. 2069	
	Flashers at Herman St.	Rev. to agree with detail plan.	Sup'ds. Dwg No. PA-12 Sh.17 Dated 6-10-47
By	J.A.T. G.E.G.	C.E.S.	
Field Check	V.G.S. 4-9-59	G.C.S. 9-30-47	
In Service	4-9-59	9-30-47	

AFE-2609
Drawn F.D.M.
Traced
Checked F.D.M.

WABASH R.R. | SIGNAL DEPT. | DECATUR, ILL.

STRAWN TO SIBLEY, ILLINOIS
TRACK AND CIRCUIT DIAGRAM

JUNE 11, 1947 | SHEET NO. 1 | CS10 120-10330